







Certified Inspection Report for: Barby & Onley Parish Council Hopthorne Farm, 18 Kilsby Road, Barby Rugby, Warwickshire CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk	Order No: 402972	Site Address: Barby Village Hall Daventry Road, Barby CV23 8TT	SHEET 2 of 5		
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Bark Surface		M	Monitor and maintain the bark depth at a minimum 300mm. Remove any weed growth and deep rake regularly to ensure even distribution and the removal of foreign objects including animal faeces. Displacement of Bark under areas of movement may reduce impact attenuation properties. (ref BS EN 1176:2017 Part 1 Section 4.2.8.5.1.)					
Rolling Barrel on Grass	unknown		Satisfactory condition.					
Trim Trail on Grass	Playdale?		Items are installed as a cluster (ref BS EN 1176:2017 Part 1 Section 3.19 and Section 4.2.8.3; note 1) and consist of the following:-					
Swinging Steps		L	Monitor splits in the posts and step logs.					
Crossed Chain Walk		L	Monitor splits in the posts for wood rot and splinter hazards.					
5 x Timber Step Posts		L	3 posts are missing. Monitor grass areas where the posts have been removed for trip hazards.					
Burma Chain Bridge		L	Monitor the timber condition for wood rot and splinter hazards.					
4 x Timber Step Posts			Satisfactory condition.					
Spring Wobble Board			Satisfactory condition.					
4 x Timber Step Posts		L	Monitor the timber condition for wood rot and splinter hazards.					
Inclined Balance Beam		L	Monitor minor wood rot in the beam.					
Tightrope Chains			Satisfactory condition.					
Inclined Balance Beam		M	Wood rot evident in the top of the beam. Beam is 3m long x 140mm diameter. We are unable to obtain beams of this size. Recommend the beam and the short post are removed.					
General (Trim Trail)			Most items are in generally poor condition. Repairs are unlikely to be feasible. Recommend regular monitoring, and consider replacing within approximately 12 months.					
						Continues on next sheet...		
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY : - A J Hayes DATE : - 24. 08. 2018	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	£0.00 £0.00 £0.00 See sheet 4			



Certified Inspection Report for: Barby & Onley Parish Council Hopthorne Farm, 18 Kilsby Road, Barby Rugby, Warwickshire CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk	Order No: 402972	Site Address: Barby Village Hall Daventry Road, Barby CV23 8TT	SHEET 3 of 5		
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Roundabout on Safety Grass	unknown	M M M	Vertical movement of platform deck may indicate either bearings are worn, or spindle is loose in ground fixing. Fails BS EN 1176:2017 design recommendations at the following areas:- M Fails BS EN 1176 Ground Clearance (Ref BS EN 1176:2017 Part 5 Section 5.2.1) Ground clearance below deck should be between 60mm and 110mm, for a distance of 300mm towards centre of rotation. Clearance on this item is currently approx 120mm to 140mm, and varies due to undulations in safety grass surface. Also, lifting edges of safety grass mats may create risk of foot / ankle injuries to users undergoing forced movement with the rotation of the roundabout. M Underside of the platform is not smooth, which may cause injury in the event of a child becoming trapped below deck. (Ref BS EN 1176:2017 Part 5 Section 5.2.3) We cannot identify the manufacturer, and are unable to quote for repairs to this item.					
Timber Ship on Bark	Sovereign 2017/18	L VL	L Fails BS EN 1176 Head & Torso Probe Test at the opening below the angled braces at 3 places (Ref BS EN 1176:2017 Part 1 Section 4.2.7.2) Refer to Sovereign for advice and rework to reduce entrapment hazards. VL This item does not have an original manufacturer's information label (Ref BS EN 1176:2017 Part 1 Section 7.)					
Bike Spring Mobile on Bark	Wicksteed 2009/10	MH L	MH The missing nut at the spring to body fixing was replaced at the time of the inspection. L Generally satisfactory, but foot rests fail BS EN 1176 Ring Gauge Test (Ref BS EN 1176:2017 Part 6 Section 4.7) No remedial action is recommended at present.	1		M10 Nut	FOC	
						Continues on next sheet...		
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		H/MH M VL/L	INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY : - A J Hayes DATE : - 24. 08. 2018	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	£0.00 £0.00 £0.00	See sheet 5	



Certified Inspection Report for: Barby & Onley Parish Council Hopthorne Farm, 18 Kilsby Road, Barby Rugby, Warwickshire CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk	Order No: 402972	Site Address: Barby Village Hall Daventry Road, Barby CV23 8TT			SHEET 4 of 5
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Timber Cabin Slide on Bark	Sovereign 2017/18	L	Area of damage to 1 corner post has been filled. The filler has been removed. This creates splinter hazards. Refer to Sovereign for rework as required.					
		VL	This item does not have an original manufacturer's information label (Ref BS EN 1176:2017 Part 1 Section 7.)					
1.8m 1 Bay Timber Swing 2 x Cradle Seats on Bark	Playdale	L	Monitor timber condition for wood rot and splinter hazards.					
		L	Monitor wear on bushes. Consider replacing this item in the longer term.					
Bark Surface		M	Monitor and maintain the bark depth at a minimum 300mm. Remove any weed growth and deep rake regularly to ensure even distribution and the removal of foreign objects including animal faeces. Displacement of Bark under areas of movement may reduce impact attenuation properties. (ref BS EN 1176:2017 Part 1 Section 4.2.8.5.1.)					
		L	Recommend the damaged timber edging is replaced.					
Memorial Seat on Concrete	unknown		Satisfactory condition.					
Litter Bin	unknown		Satisfactory condition.					
General		M	Access by dogs is not physically prevented and routine inspection should include monitoring and removal of animal faeces. (Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free from animal faeces)					
						Continues on next sheet...		
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY : - A J Hayes DATE : - 24. 08. 2018	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	£0.00 £0.00 £0.00 See sheet 5	

Certified Inspection Report for: Barby & Onley Parish Council Hopthorne Farm, 18 Kilsby Road, Barby Rugby, Warwickshire CV23 8TT		Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk	Order No: 402972 Site Address: Barby Village Hall Daventry Road, Barby CV23 8TT	SHEET 5 of 5
---	--	---	--	---



DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
General (continued)		L	The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number (999 or 112) b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2017 clause 8.2.4)			A variety of signs are available from Wicksteed sales Dept		
		Note	It is the responsibility of the playground owner / operator to maintain equipment in a safe condition. This includes tightening of fixings, and replacing worn, damaged and rotten parts etc as required. (Ref BS EN 1176:2017 Part 7)					
Multi Sports Goal on Tarmac	SMP	L	Monitor minor damage to 1 goal mesh panel.					
		L	Recommend missing fixing at the backboard, and 2 missing fixings on the mesh panels are replaced.					
Litter Bin	unknown		Satisfactory condition.					
Seat Rest	unknown		Satisfactory condition.					
2 x Football Goals on Grass	unknown	L	Monitor security of the ground fixing.					
Free Standing Basketball Goal on Tarmac	unknown		Satisfactory condition, but ensure that this area is not used for play when it is in use as an overflow car park for the Village Hall or church.					
Gates		L	Recommend intrusive brambles etc are cut back as required to allow safe access, in particular at eye level.					








 	Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY : - A J Hayes DATE : - 24. 08. 2018	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT	£0.00 £0.00 £0.00 £0.00
	www.wicksteed.co.uk					

Certified Inspection Report for: Barby & Onley Parish Council Hopthorne Farm, 18 Kilsby Road, Barby Rugby, Warwickshire CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk	Order No: 402972	Site Address: Barby Sports Field Longdown Lane, Barby CV23 8TE	SHEET 1 of 1		
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Half Pipe Skate Ramp General	unknown	L	<p>Inspected to the design recommendations of BS EN 14974:2006 & A1:2010 for roller sports equipment, for use of in-line skates, roller skates, skateboards or similar sports equipment as well as BMX cycles. (it is recommended that replacement parts (where required) are sourced from the original manufacturer to ensure correct fitting and compatible materials, especially at curved / formed riding surfaces)</p> <p>Satisfactory condition.</p> <p>The provision of a clear and visible sign is recommended to indicate the following: (a) facility is for users of in-line skates, roller skates, skateboards and BMX cycles. (b) Use of appropriate protective equipment (e.g. helmet knee pads, elbow pads etc) is recommended. (c) administrator's identification. (Ref BS EN 14974:2006 Section 9)</p> <p>Recommend intrusive brambles etc at entry point from field gate are cut back as required to reduce hazards, in particular at eye level.</p> <p>Recommend the hole in the grass area at the edge of the concrete next to the cricket field is filled to reduce trip hazards.</p>					
 			Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028	INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY : - A J Hayes DATE : - 24. 08. 2018	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT	£0.00 £0.00 £0.00 £0.00	



Certified Inspection Report for: Barby & Onley Parish Council Hopthorne Farm, 18 Kilsby Road, Barby Rugby, Warwickshire CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk	Order No: 402972	Site Address: Onley Park, Onley, Willoughby CV23 8AN	SHEET 1 of 3		
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
1.9m 1 Bay Timber Swing 1 x Cradle Seat on Safety Grass	Playdale	L	Monitor the splits and damage to the base of the timber posts.					
		L	Monitor minor surface corrosion on the chains.					
Multiplay Unit on Safety Grass	Playdale	M	Wear / damage to the rope net climber creates hazards to users. Recommend this is replaced. First reported December 2014.			Cost to replace parts is available on request		
		M	The fixings at the top of the access ramp into the platform are loose. Recommend these are tightened to prevent the ramp falling under the weight of a child climbing. Fails BS EN 1176:2017 design recommendations at the following areas:-					
		L	Access net ground fixing bar creates a potential trip and impact hazard within the falling space (ref: BS EN 1176:2017, Part 1 Sections 4.2.8.6 & 4.2.8.4 respectively. No remedial action is possible with the unit design.					
		L	Metal slide chute faces towards the sun. Monitor for high temperatures during hot, sunny weather conditions.					
		L	Non-manufacturer's parts have been used to cover over the original platform deck. Recommend genuine manufacturer's parts are used for repairs (Ref BS EN 1176:2017 Part 1 Section 6.1.4)					
High Arch Climber on Safety Grass	Wicksteed 1993	L	Monitor the corroded fixings at the top centre joint.					
2.3m 1 Bay Swing 2 x Flat Seats on Safety Grass	Hags SMP 2013	M	Recommend the missing safety grass mats are replaced as soon as possible to reduce trip hazards and risk of foot / ankle injury to users undergoing forced movement. Refer to the manufacturer / installers for advice. First reported December 2014.					
						Continues on next sheet...		
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			INDICATION OF RISK RATING ASSESSMENT H/M/H HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes V/L/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY : - A J Hayes DATE : - 24. 08. 2018	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	£0.00 £0.00 £0.00 See sheet 3	

Certified Inspection Report for: Barby & Onley Parish Council Hopthorne Farm, 18 Kilsby Road, Barby Rugby, Warwickshire CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk	Order No: 402972	Site Address: Onley Park, Onley, Willoughby CV23 8AN	SHEET 2 of 3		
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
2.4m Rota Web Climber on Safety Grass	Tayplay 2001	VL	Generally satisfactory but fails the design recommendations of BS EN 1176:2017 in the following areas; Fails BS EN 1176 Ground Clearance (Ref BS EN 1176:2017 Part 5 Section 5.) Ground clearance below outer ring should be 400mm (350mm actual in places) Recommend monitoring at present.					
Dog Spring Mobile (Green / Brown) on Safety Grass	Ausplay		Satisfactory condition.					
Butterfly Spring Mobile (Brown / Blue) on Safety Grass	Ausplay		Satisfactory condition.					
Animal Spring Mobile (Blue / Yellow) on Safety Grass	Ausplay	L	Generally satisfactory, but foot rests fail BS EN 1176 Ring Gauge Test (Ref BS EN 1176:2008 Part 6 Section 4.7) No remedial action is recommended at present.					
Memorial Seat	unknown		Satisfactory condition.					
Timber Fence & Gate	unknown	M	Many fence posts are broken at ground level, and some sections are not secure. The gate rubs on the ground. All parts are in poor condition. Recommend the complete fence and gate are replaced.					
General		L	The area lacks litter facilities (recommended)					
						Continues on next sheet...		
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		H/MH M VL/L	INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY : - A J Hayes DATE : - 24. 08. 2018	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	£0.00 £0.00 £0.00 See sheet 3		

Certified Inspection Report for: Barby & Onley Parish Council Hopthorne Farm, 18 Kilsby Road, Barby Rugby, Warwickshire CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk	Order No: 402972	Site Address: Onley Park, Onley, Willoughby CV23 8AN	SHEET 3 of 3		
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Operator's Sign		L	Generally satisfactory, but note that the following information is recommended, in pictogram form: a) General emergency telephone number (999 or 112) b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2017 clause 8.2.4)			A variety of signs are available from Wicksteed Sales Dept		
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 www.wicksteed.co.uk			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :- A J Hayes DATE :- 24. 08. 2018		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT	£0.00 £0.00 £0.00 £0.00	