











Certified Inspection Report for: Barby & Onley Parish Council 18 Kilsby Road, Barby, Rugby CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk		Order No: 1252435 / 411398			Site Address: Barby Village Hall Daventry Road, Barby CV23 8TT		SHEET 1 of 5
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL		
Free Standing Slide Ref 4051 on Safety Grass	Play & Leisure 2020	L	Metal slide chute faces toward the sun. Monitor for high temperatures during hot, sunny weather conditions. (Ref BS EN 1176:2017 Part 1 Section 6.1.3)							
2.4m 2 Bay Timber Swing 2 x Flat Seats 1 x Basket on Safety Grass	A E Evans 2020	L	Dips in the safety grass surface below the flat seats and the basket may create hazards to users.							
		L	Marginally fails BS EN 1176 Seat Height criteria. Recommended seat height should be minimum 400mm from the playing surface when measured from the underside of the rigid part of the basket in its most onerous position (Ref BS EN 1176:2017 Part 2 Section 4.2) Refer to the manufacturers for advice.							
		L	Monitor the splits in the timber posts for splinter hazards and reduced structural integrity.							
Rolling Barrel on Grass	unknown		Satisfactory condition.							
Net Tunnel on Grass	Pentagon 2018/19	L	Monitor the splits in the timber posts for splinter hazards and reduced structural integrity.							
		VL	This item does not have an original manufacturer's information label (Ref BS EN 1176:2017 Part 1 Section 7.)							
Log / Rope Climber on Grass	Pentagon 2018/19		Satisfactory condition.							
Chin Up Bars on Grass	Pentagon 2018/19	L	Monitor the splits in the timber posts for splinter hazards and reduced structural integrity.							
		VL	This item does not have an original manufacturer's information label (Ref BS EN 1176:2017 Part 1 Section 7.)							
Continues on next sheet...										
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		H/MH M VL/L	INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY : - A J Hayes DATE : - 14. 09. 2020	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	£0.00 £0.00 £0.00 See sheet 5				




Certified Inspection Report for: Barby & Onley Parish Council 18 Kilsby Road, Barby, Rugby CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk		Order No: 1252435 / 411398			Site Address: Barby Village Hall Daventry Road, Barby CV23 8TT		SHEET 2 of 5
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL		
Trapeze Rings on Safety Grass	Pentagon 2018/19	L	Monitor the splits in the timber posts for splinter hazards and reduced structural integrity.							
		L	Monitor security of the ground fixing. Slight movement evident at the time of the inspection.							
		VL	This item does not have an original manufacturer's information label (Ref BS EN 1176:2017 Part 1 Section 7.)							
Roundabout on Ecotumble	unknown	M	Vertical movement of platform deck may indicate either bearings are worn, or spindle is loose in ground fixing. Fails BS EN 1176:2017 design recommendations at the following areas:-							
		M	Underside of the platform is not smooth, which may cause injury in the event of a child becoming trapped below deck. (Ref BS EN 1176:2017 Part 5 Section 5.2.3) We cannot identify the manufacturer, and are unable to quote for repairs to this item.							
		Note	The notes above were first reported March 2013. The Safety Grass playing surface was replaced with Ecotumble 2019/20.							
Timber Ship on Bark	Sovereign 2017/18	L	Fails BS EN 1176 Head & Torso Probe Test at the opening below the angled braces at 3 places (Ref BS EN 1176:2017 Part 1 Section 4.2.7.2) Refer to Sovereign for advice and rework to reduce entrapment hazards.							
		VL	This item does not have an original manufacturer's information label (Ref BS EN 1176:2017 Part 1 Section 7.)							
Bike Spring Mobile on Bark	Wicksteed 2009/10	L	Generally satisfactory, but foot rests fail BS EN 1176 Ring Gauge Test (Ref BS EN 1176:2017 Part 6 Section 4.7) No remedial action is recommended at present.							
Continues on next sheet...										
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		H/MH M VL/L	INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY : - A J Hayes DATE : - 14. 09. 2020	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	£0.00 £0.00 £0.00 See sheet 4				



Certified Inspection Report for: Barby & Onley Parish Council 18 Kilsby Road, Barby, Rugby CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk		Order No: 1252435 / 411398			Site Address: Barby Village Hall Daventry Road, Barby CV23 8TT		SHEET 3 of 5
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL		
Timber Cabin Slide on Bark	Sovereign 2017/18	L	Area of damage to 1 corner post has been filled. The filler has been removed. This creates splinter hazards. Refer to Sovereign for rework as required.							
		VL	This item does not have an original manufacturer's information label (Ref BS EN 1176:2017 Part 1 Section 7.)							
1.8m 1 Bay Timber Swing 2 x Cradle Seats on Bark	Playdale	M	Recommend the worn swing suspension bushes are replaced, in particular the bush at the position nearest to the spring mobile is badly worn. Cost to replace the bushes is available on request.							
		L	Monitor timber condition for wood rot and splinter hazards. The swing is in generally poor condition. Consider replacing in the longer term.							
Bark Surface		M	Monitor and maintain the bark depth at a minimum 300mm. Remove any weed growth and deep rake regularly to ensure even distribution and the removal of foreign objects including animal faeces. Displacement of Bark under areas of movement may reduce impact attenuation properties. (ref BS EN 1176:2017 Part 1 Section 4.2.8.5.1.)							
Memorial Seat on Concrete	unknown		Satisfactory condition, but would benefit from cleaning.							
Bench	unknown		Satisfactory condition.							
Litter Bin	unknown		Satisfactory condition.							
Continues on next sheet...										
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY : - A J Hayes DATE : - 14. 09. 2020		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		£0.00 £0.00 £0.00 See sheet 5		



Certified Inspection Report for: Barby & Onley Parish Council 18 Kilsby Road, Barby, Rugby CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk		Order No: 1252435 / 411398			Site Address: Barby Village Hall Daventry Road, Barby CV23 8TT		SHEET 4 of 5
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL		
Operator's Sign		L	Generally satisfactory, but note that the following information is recommended, in pictogram form: a) General emergency telephone number (999 or 112) b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2017 clause 8.2.4)							
General		M	Access by dogs is not physically prevented and routine inspection should include monitoring and removal of animal faeces. (Litter (animal droppings) order 1991of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free from animal faeces)							
Multi Sports Goal on Tarmac	SMP	L L	Monitor minor damage to 1 goal mesh panel. Recommend missing fixing at the backboard, and 2 missing fixings on the mesh panels are replaced.							
Litter Bin	unknown		Satisfactory condition.							
Seat Rest	unknown		Satisfactory condition.							
2 x Football Goals on Grass	unknown	L	Monitor security of the ground fixing.							
Combination Power Push Pull Down Challenger on Grass	Sunshine Gym 2019		Satisfactory condition.							
Continues on next sheet...										
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		H/MH M VL/L	INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY : - A J Hayes DATE : - 14. 09. 2020	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	£0.00 £0.00 £0.00 See sheet 5				



Certified Inspection Report for: Barby & Onley Parish Council 18 Kilsby Road, Barby, Rugby CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk		Order No: 1252435 / 411398			Site Address: Barby Village Hall Daventry Road, Barby CV23 8TT		SHEET 5 of 5
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL		
Free Standing Basketball Goal on Tarmac Gates	unknown	L	Satisfactory condition, but ensure that this area is not used for play when it is in use as an overflow car park for the Village Hall or church. Recommend intrusive brambles etc are cut back as required to allow safe access, in particular at eye level.							
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 www.wicksteed.co.uk			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY : - A J Hayes DATE : - 14. 09. 2020		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT		£0.00 £0.00 £0.00 £0.00	



Certified Inspection Report for: Barby & Onley Parish Council 18 Kilsby Road, Barby, Rugby CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk		Order No: 1252435 / 411398			Site Address: Barby Sports Field Longdown Lane, Barby CV23 8TE		SHEET 1 of 1		
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL				
Half Pipe Skate Ramp General	unknown		<p>Inspected to the design recommendations of BS EN 14974:2006 & A1:2010 for roller sports equipment, for use of in-line skates, roller skates, skateboards or similar sports equipment as well as BMX cycles. (it is recommended that replacement parts (where required) are sourced from the original manufacturer to ensure correct fitting and compatible materials, especially at curved / formed riding surfaces)</p> <p>Satisfactory condition.</p> <p>L The provision of a clear and visible sign is recommended to indicate the following: (a) facility is for users of in-line skates, roller skates, skateboards and BMX cycles. (b) Use of appropriate protective equipment (e.g. helmet knee pads, elbow pads etc) is recommended. (c) administrator's identification. (Ref BS EN 14974:2019 Section 9)</p> <p>L Recommend intrusive brambles etc at the entry point from the field gate are cut back as required to reduce hazards, in particular at eye level.</p>									
 			Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY : - A J Hayes DATE : - 14. 09. 2020				PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT	£0.00 £0.00 £0.00 £0.00
www.wicksteed.co.uk												

Certified Inspection Report for: Barby & Onley Parish Council 18 Kilsby Road, Barby, Rugby CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk		Order No: 1252435 / 411398			Site Address: Onley Park, Onley, Willoughby CV23 8AN Next to No 89		SHEET 1 of 3
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL		
1.9m 1 Bay Timber Swing 1 x Cradle Seat on Safety Grass	Playdale	L	Monitor the splits and damage to the base of the timber posts.							
		L	Monitor THE surface corrosion on the chains.							
Multiplay Unit on Safety Grass	Playdale	M	Wear / damage to the rope net climber creates hazards to users. Recommend this is replaced. First reported December 2014.			Cost to replace parts is available on request				
		M	The fixings at the top of the access ramp into the platform are loose. Recommend these are tightened to prevent the ramp falling under the weight of a child climbing. This was first reported August 2018. Fails BS EN 1176:2017 design recommendations at the following areas:-							
		L	Access net ground fixing bar creates a potential trip and impact hazard within the falling space (ref: BS EN 1176:2017, Part 1 Sections 4.2.8.6 & 4.2.8.4 respectively. No remedial action is possible with the unit design.							
		L	Metal slide chute faces towards the sun. Monitor for high temperatures during hot, sunny weather conditions.							
		L	Non-manufacturer's parts have been used to cover over the original platform deck. Recommend genuine manufacturer's parts are used for repairs (Ref BS EN 1176:2017 Part 1 Section 6.1.4)							
High Arch Climber on Safety Grass	Wicksteed 1993	L	Monitor the corroded fixings at the top centre joint.							
2.3m 1 Bay Swing 2 x Flat Seats on Safety Grass	Hags SMP 2013	M	Recommend the missing safety grass mats are replaced as soon as possible to reduce trip hazards and risk of foot / ankle injury to users undergoing forced movement. Refer to the manufacturer / installers for advice. First reported December 2014.							
						Continues on next sheet...				
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- A J Hayes DATE :- 14. 09. 2020		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		£0.00 £0.00 £0.00 See sheet 3		

Certified Inspection Report for: Barby & Onley Parish Council 18 Kilsby Road, Barby, Rugby CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk		Order No: 1252435 / 411398			Site Address: Onley Park, Onley, Willoughby CV23 8AN Next to No 89		SHEET 2 of 3
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL		
2.4m Rota Web Climber on Safety Grass	Tayplay 2001	VL	Generally satisfactory but fails the design recommendations of BS EN 1176:2017 in the following areas; Fails BS EN 1176 Ground Clearance (Ref BS EN 1176:2017 Part 5 Section 5.) Ground clearance below outer ring should be 400mm (370mm actual in places) Recommend monitoring at present.							
Dog Spring Mobile (Green / Brown) on Safety Grass	Ausplay		Satisfactory condition.							
Butterfly Spring Mobile (Brown / Blue) on Safety Grass	Ausplay		Satisfactory condition.							
Animal Spring Mobile (Blue / Yellow) on Safety Grass	Ausplay	L	Generally satisfactory, but foot rests fail BS EN 1176 Ring Gauge Test (Ref BS EN 1176:2017 Part 6 Section 4.7) No remedial action is recommended at present.							
Memorial Seat	unknown		Satisfactory condition.							
Timber Fence & Gate	unknown	L	Monitor the wood rot in the gate. Note also that the gate does not self-close, due to the weight of the gate.							
General		L	The area lacks litter facilities (recommended)							
		L	The plant with berries near the gate may be harmful, in particular to younger children. Refer to a competent person for advice as required.							
						Continues on next sheet...				
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- A J Hayes DATE :- 14. 09. 2020		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		£0.00 £0.00 £0.00 See sheet 3		

Certified Inspection Report for: Barby & Onley Parish Council 18 Kilsby Road, Barby, Rugby CV23 8TT			Contact: Catherine Camp Tel: 01788 891 184 / 07759 271 507 Email: clerk@barbyandonleyparishcouncil.co.uk		Order No: 1252435 / 411398			Site Address: Onley Park, Onley, Willoughby CV23 8AN Next to No 89		SHEET 3 of 3
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL		
Operator's Sign		L	Generally satisfactory, but note that the following information is recommended, in pictogram form: a) General emergency telephone number (999 or 112) b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2017 clause 8.2.4) Note that the emergency number shown on the sign is 101 not 999.			A variety of signs are available from Wicksteed Sales Dept				
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 www.wicksteed.co.uk			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- A J Hayes DATE :- 14. 09. 2020		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT		£0.00 £0.00 £0.00 £0.00	

